

SERVICE BULLETIN

<input type="checkbox"/>	Action Required
<input checked="" type="checkbox"/>	Only If Problem Encountered
<input type="checkbox"/>	Information Only

To: All Dealers and Customers
Bulletin Number: B170008A-02
Date: 10-March-2017
Brands: Poulan Pro
Product: Zero Turn Mowers (461ZX, 541ZX, P46ZX, P54ZX)
Dates Produced: 03-Jan-2011 to 21-Oct-2016
Affected Market(s): North America

Description/Background:

After several hours of use, hydro drive bushings in the drive idler arm could seize. This could lead to idler pulley and belt failure. If encountered, the unit may have reduced drive or no drive.

Action Required:

Affected units not yet sold to consumers are not approved for this service. This service is required only if the issue described is encountered on units coming in for service. Normal warranty applies

Warranty Reporting:

Perform service through Husqvarna's warranty process using only this information:

Component code: **451 – Drive System**
 Defect code: **92 – Part exchanged on request by Husqvarna**
 Warranty type: Must be on unit sold to consumer and use **1 – warranty**
 Time Units: 5 units (30 minutes)

Part Ordering:

Part number: 589543901
 Description: Idler arm kit contains: idler arm, flange bearings, idler pulley, mounting hardware and instructions.

Affected Serial Number Range:

The affected serial numbers include the following ranges:

- **010311CXXXXX** to **102116CXXXXX**

Models Affected:

POULAN PRO BRAND					
966681801	966681802	966681901	967330901	967331001	967333801

If you have questions, contact us.

Husqvarna Dealers call 1-800-448-7543
 All other customers call 1-800-487-5951