

<input checked="" type="checkbox"/>	Action Required:
<input checked="" type="checkbox"/>	Sold
<input checked="" type="checkbox"/>	Not Sold
<input type="checkbox"/>	Only If Encountered
<input type="checkbox"/>	Information Only

SB, Fuel Hose Contact with Rear Tire, Poulan Pro Zero Turn Mowers Equipped with Briggs & Stratton Twin Cylinder Engines, P54ZX, 2017-12

Affected Models

Model	PNC	Serial Range Start	Serial Range End
P54ZX	967331001	070117C001001	110717C999999

Affected Market(s)

United States

Description

Routing of the fuel hose can potentially result in contact between the fuel hose and the right rear tire. Contact may result in rubbing and abrasion of the fuel hose, which creates the potential for leakage of fuel.

Units inspected at the warehouse are identified with a green label "OK Inspected". No action is required if the crate has a Green Label affixed to the crate tag.



	Product sold to end users	Residual inventory not yet sold
What is required	Service is required	Service is required
When to do	Contact customers now	Immediately
What to do	Service includes inspection of fuel hose. If fuel hose shows evidence of contact with the right rear tire, a wire tie must be installed to prevent fuel hose contact with tire. If any sign of abrasion to the fuel hose, the fuel hose assembly must be replaced.	
How to do	See "Additional information"	



Service Bulletin B170066C-14

<input checked="" type="checkbox"/> Action Required:
<input checked="" type="checkbox"/> Sold <input checked="" type="checkbox"/> Not Sold
<input type="checkbox"/> Only If Encountered
<input type="checkbox"/> Information Only

Parts Information

Replacement part number	Part description	Quantity	Old part number
532 00 71-92	Wire Tie	1	-
586 12 39-04	Fuel Hose Shut Off	1	

Warranty Reporting Information

A warranty claim must be filed for each unit serviced, even if service is labor only. Please include full serial number. All claims must be sent through our warranty process using only the information listed below:

Field	Selection or Entry
Claim Type (inventory)	04 – Requested by Factory
Claim Type (end users)	01 – Warranty
Failure Description	Service Bulletin # B170066A-14
Component code	173 – Hose
Defect code	92 – Part exchanged on request by Husqvarna
Symptom code	-
Labor Allowance	3 units (18 minutes)

On site repairs (preferred method)

Service call - Additional 10 units of labor per location.

In shop repairs

Pickup and delivery if required – paid based off mileage.

Customer Drop off

Follow bulletin and file as stated above.
(3 units of labor)

<input checked="" type="checkbox"/>	Action Required:		
<input checked="" type="checkbox"/>	Sold	<input checked="" type="checkbox"/>	Not Sold
<input type="checkbox"/>	Only If Encountered		
<input type="checkbox"/>	Information Only		


Additional Information

Instructions for service

Tools/equipment needed:

1. Flashlight
2. Wire Cutters

- Step 1.** Using a flashlight, check the position of the fuel hose. The picture on the left shows incorrect routing where fuel hose contacts the Right Rear Tire (Picture 1). The picture on the right (Picture 2) shows the correct routing where fuel hose is positioned on the engine plate away from the tire.

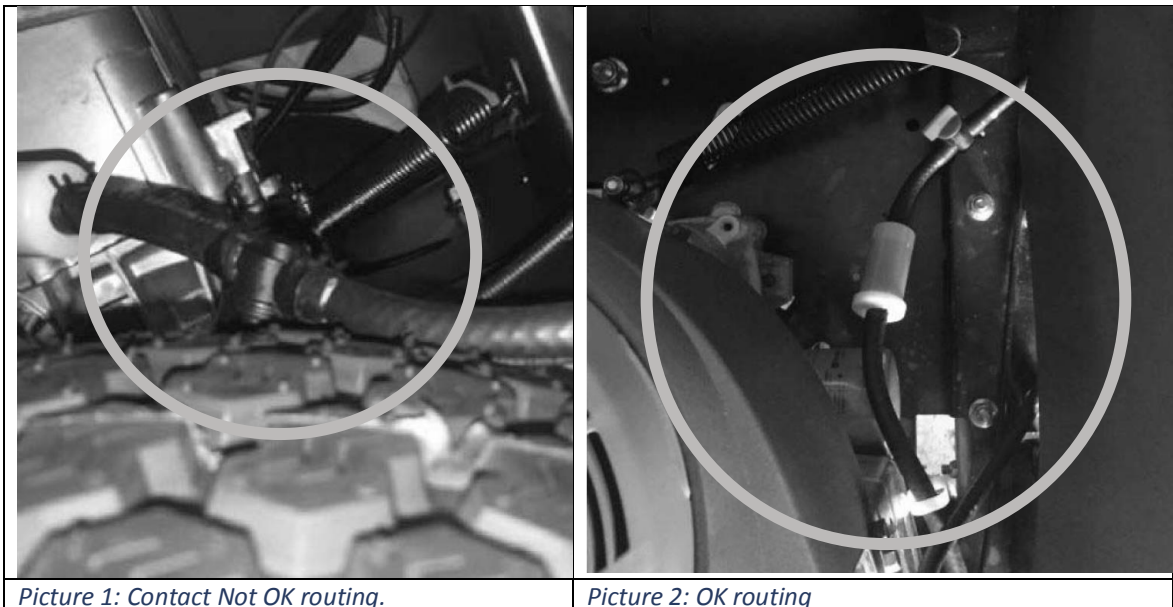


- Step 2.** Check fuel hose for damage. If any damage is observed, replace fuel hose assembly.

Note: If fuel hose has no damage and routing is correct, service is not required.

- Step 3.** If routing is incorrect, route fuel hose near seat support and loosely secure the fuel hose to the seat support with a wire tie. See Picture 3.

<input checked="" type="checkbox"/>	Action Required:		
<input checked="" type="checkbox"/>	Sold	<input checked="" type="checkbox"/>	Not Sold
<input type="checkbox"/>	Only If Encountered		
<input type="checkbox"/>	Information Only		

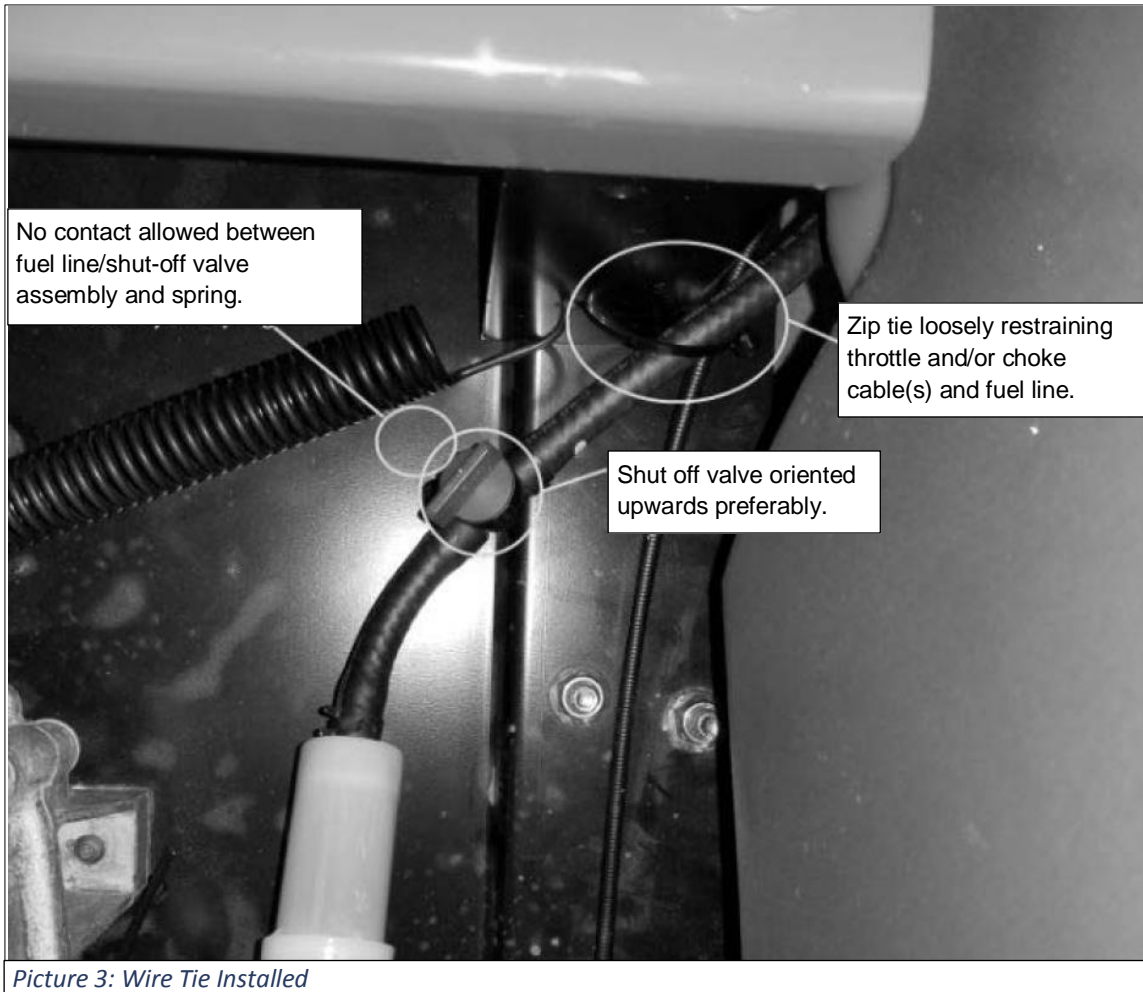

Step 4. Upon completion of inspection and service, mark the unit with a green dot label and the number "17-18". If the unit is still in the crate, add label to outer packaging label. If no longer in crate, add label to upper right corner of the serial number plate.

Revision History

Revision	Date	Description
A	12-2017	Created
B	01-2018	Changed number for green dot label (17-66 → 17-18)
C	02-2018	Changed Affected Markets, Added Warranty info