



<input type="checkbox"/>	Action Required:
<input type="checkbox"/>	Sold
<input type="checkbox"/>	Not Sold
<input type="checkbox"/>	Only If Encountered
<input checked="" type="checkbox"/>	Information Only

SMB, Belt Failure from Pulley Misalignment, Poulan Pro Tillers, HDF900, PPCRT14, PPCRT17, PRRT900, PRRT901, RT900, 2018-02

Affected Models

Model	PNC	Serial Range Start	Serial Range End
HDF900	960820032	110112MXXXXXX	063014MXXXXXX
HDF900	960820035	110115MXXXXXX	022818MXXXXXX
HDF900	960820034	110113MXXXXXX	063014MXXXXXX
PPCRT14	960920038	110115MXXXXXX	022818MXXXXXX
PPCRT17	960920037	110115MXXXXXX	022818MXXXXXX
PRRT900	960920030	110112MXXXXXX	063015MXXXXXX
PRRT900	960920033	110113MXXXXXX	063014MXXXXXX
PRRT901	960920034	110114MXXXXXX	063015MXXXXXX
RT900	960920029	110112MXXXXXX	063014MXXXXXX

Affected Market(s)

Canada, United States.

Description

Models produced in the S/N ranges above had a potential for the drive pulley to slip out of position if set screw was not tightened adequately. This would lead to premature belt wear and breakage. The pulley has been improved by adding an additional set screw securely fastening the pulley to the engine crankshaft.

	Product sold to end users	Residual inventory not yet sold
What is required	Service is not approved	Service is not approved
When to do	Not required	Not required
What to do	Information only	
How to do	Information only	

Parts Information

Replacement part number	Part description	Quantity	Old part number
592642101	Pulley.asm.engine.4L.2.50	1	(582032001) or (130812)

Warranty Reporting Information

Warranty is not approved; information only.

Revision History

Revision	Date	Description
A	02-2018	Created

Confidential!